



- Revisions/Rework:
- Pin 11 of PAL2 (U20) must be pulled because it is an input pin. Socket pin must be soldered to GND.
 - DS90C031(432)/SO output enable is the OR of the 2 enable signals. In future, tie pin 12 to Vcc. However, no immediate need to rework.
 - Pin 12 of PAL1 is an output pin and in future should not be tied to GND. No immediate need to rework.